

INTERNATIONAL  
STANDARD

ISO  
6621-2

Second edition  
2003-11-15

**Internal combustion engines —  
Piston rings —**

**Part 2:  
Inspection measuring principles**

*Moteurs à combustion interne — Segments de piston —  
Partie 2: Principes de mesure pour inspection*

STANDARDSISO.COM : Click to view the full PDF of ISO 6621-2:2003



Reference number  
ISO 6621-2:2003(E)

© ISO 2003

**PDF disclaimer**

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 6621-2:2003

© ISO 2003

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
Case postale 56 • CH-1211 Geneva 20  
Tel. + 41 22 749 01 11  
Fax + 41 22 749 09 47  
E-mail [copyright@iso.org](mailto:copyright@iso.org)  
Web [www.iso.org](http://www.iso.org)

Published in Switzerland

## Contents

	Page
<b>Foreword</b> .....	iv
<b>Introduction</b> .....	v
<b>1 Scope</b> .....	1
<b>2 Normative references</b> .....	1
<b>3 Terms and definitions</b> .....	1
<b>4 Measuring principles</b> .....	1
<b>4.1 General measuring conditions</b> .....	1
<b>4.2 Ring characteristics and their measurement</b> .....	2
<b>4.2.1 Ring width</b> (in millimetres) .....	2
<b>4.2.2 Radial wall thickness</b> , $a_1$ (in millimetres) .....	4
<b>4.2.3 Total free gap</b> $m, p$ (in millimetres) .....	5
<b>4.2.4 Closed gap</b> , $s_1$ (in millimetres) .....	6
<b>4.2.5 Tangential force</b> , $F_t$ (in newtons) .....	7
<b>4.2.6 Diametral force</b> , $F_d$ (in newtons) .....	13
<b>4.2.7 Ovality</b> , $U$ (in millimetres) .....	13
<b>4.2.8 Point deflection</b> , $W$ (in millimetres) .....	14
<b>4.2.9 Light tightness</b> (percentage of ring circumference) .....	14
<b>4.2.10 Taper on peripheral surface</b> (in micrometres or degrees) .....	15
<b>4.2.11 Barrel on peripheral surface</b> , $t_2, t_3$ (in millimetres) .....	16
<b>4.2.12 Land width</b> , $h_4, h_5$ (in millimetres) .....	18
<b>4.2.13 Land offset</b> (in millimetres) .....	18
<b>4.2.14 Plating/coating thickness</b> (in millimetres) .....	19
<b>4.2.15 Nitrided case depth</b> (in millimetres) .....	20
<b>4.2.16 Keystone angle</b> (in degrees) .....	21
<b>4.2.17 Obliqueness</b> (in degrees) .....	24
<b>4.2.18 Twist</b> (in millimetres) .....	24
<b>4.2.19 Unevenness</b> $T_{er}, T_{eu}$ .....	25
<b>4.2.20 Helix (axial displacement of gap ends)</b> (in millimetres) .....	27
<b>4.2.21 Free flatness</b> (in millimetres) .....	27
<b>4.2.22 Surface roughness</b> $R_a, R_z$ (in micrometres) .....	28
<b>Bibliography</b> .....	29

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 6621-2 was prepared by Technical Committee ISO/TC 22, *Road vehicles*.

This second edition cancels and replaces the first edition (ISO 6621-2:1984), which has been technically revised.

ISO 6621 consists of the following parts, under the general title *Internal combustion engines — Piston rings*:

- *Part 1: Vocabulary*
- *Part 2: Inspection measuring principles*
- *Part 3: Material specifications*
- *Part 4: General specifications*
- *Part 5: Quality requirements*

## Introduction

ISO 6621 is one of a series of International Standards dealing with piston rings for reciprocating internal combustion engines. Others are ISO 6622 [4], [5], ISO 6623 [6], ISO 6624 [7], [8], [9], [10], ISO 6625 [11], ISO 6626 [12], [13] and ISO 6627 [14].

The common features and dimensional tables presented in this part of ISO 6621 constitute a broad range of variables, and the designer selecting a particular ring type must bear in mind the conditions under which it will be required to operate. It is also essential that the designer refer to the specifications and requirements of ISO 6621-3 and ISO 6621-4 before completing a selection.

STANDARDSISO.COM : Click to view the full PDF of ISO 6621-2:2003



# Internal combustion engines — Piston rings —

## Part 2: Inspection measuring principles

### 1 Scope

This part of ISO 6621 specifies the principles to be used in the measuring for inspection purposes of piston rings for both reciprocating internal combustion engines and compressors working under analogous conditions. It is applicable to all such rings of a diameter  $\leq 200$  mm.

### 2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 4287-1:1984, *Surface roughness — Terminology — Part 1: Surface and its parameters*

ISO 4287:1997, *Geometrical Product Specifications (GPS) — Surface texture: Profile method — Terms, definitions and surface texture parameters*

ISO 6507-3, *Metallic materials — Vickers hardness test — Part 3: Calibration of reference blocks*

ISO 6621-1, *Internal combustion engines — Piston rings — Part 1: Vocabulary*

### 3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 6621-1 and in 4.2 apply.

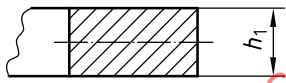
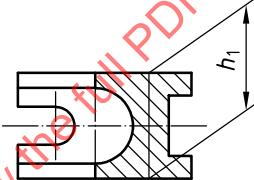
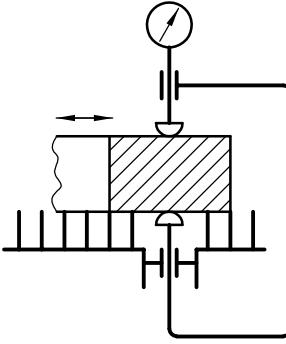
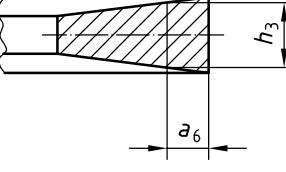
### 4 Measuring principles

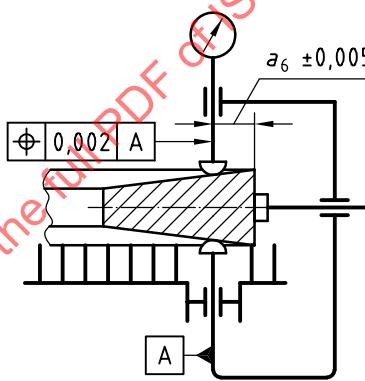
#### 4.1 General measuring conditions

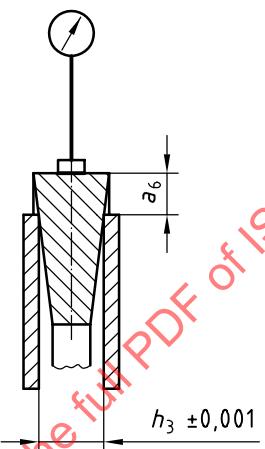
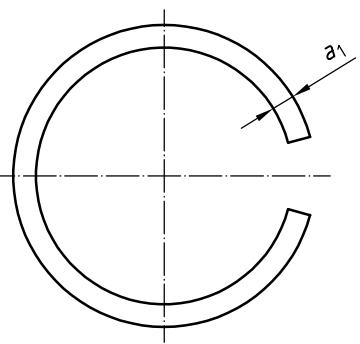
The following general conditions are applicable to all measuring principles, unless otherwise specified.

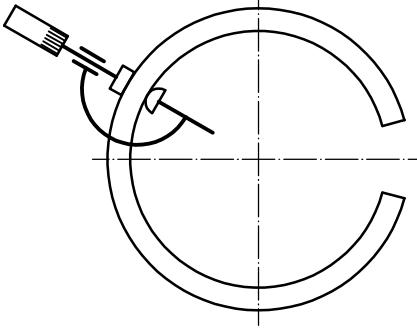
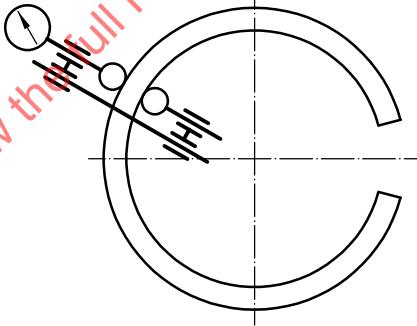
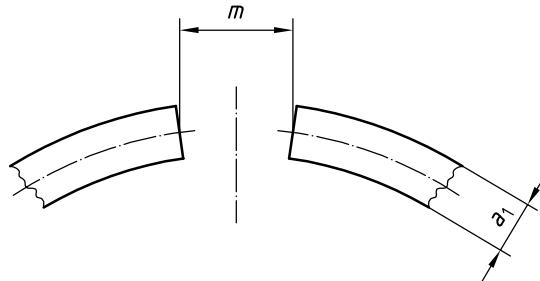
- a) The ring shall rest on the reference plane in the free or open condition. No additional force shall be applied to load the ring on the reference plane, except when measuring *unevenness* in accordance with 4.2.19 or *helix* in accordance with 4.2.20.
- b) Certain measurements are made with the ring in the closed condition in a gauge of nominal cylinder bore diameter. When orientated rings are measured in this way, they shall be so placed that the top side of the ring is towards the reference plane.
- c) Measurements shall be made using instruments with a resolution not exceeding 10 % of the tolerance of the dimension being measured.

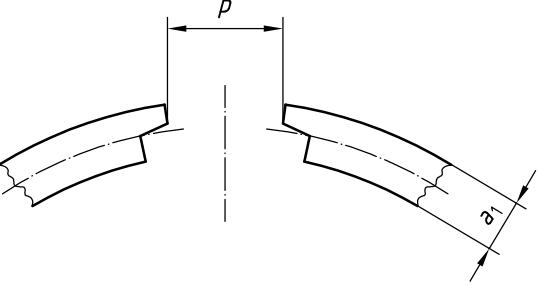
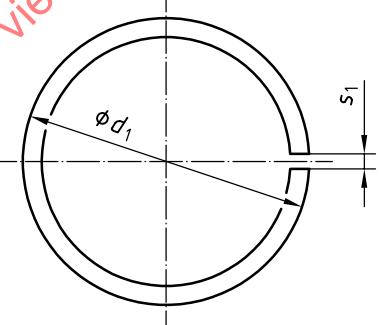
## 4.2 Ring characteristics and their measurement

Characteristic/Definition	Measuring principle/method
4.2.1 Ring width (in millimetres)	
4.2.1.1 Parallel-sided rings, $h_1$	<p>distance between the sides at any particular point perpendicular to the reference plane measured in millimetres (see Figures 1 and 2)</p> <p>Measure with spherical measuring probes, each of radius <math>1,5 \text{ mm} \pm 0,05 \text{ mm}</math>, exerting a measuring force of approximately 1 N (see Figure 3).</p> <p>In the case of slotted oil rings, the measurement shall be made between the slots and not across them, i.e. across a solid portion of the ring cross section (see Figure 2).</p>
	 <p>Figure 1</p>  <p>Figure 2</p>  <p>Figure 3</p>
4.2.1.2 Keystone rings, half-keystone rings, $h_3$	<p>Method A</p> <p>This method determines <math>h_3</math> for a specified value of <math>a_6</math> (see Figure 4).</p>
<p>distance between the sides at a distance <math>a_6</math> from the peripheral surface (see Figure 4), or, alternatively, width controlled by <math>a_6</math> at a specified width <math>h_3</math> (see Figure 6)</p>	 <p>Figure 4</p>

Characteristic/Definition	Measuring principle/method
	<p>Measure with spherical measuring probes, each of radius <math>1,5 \text{ mm} \pm 0,05 \text{ mm}</math>, exerting a measuring force of approximately 1 N (see Figure 5).</p> <p>If the measuring equipment is set up with parallel gauges instead of keystone gauges, the use of spherical measuring probes will give rise to an error, as follows:</p> <ul style="list-style-type: none"> <li>— for <math>6^\circ</math> keystone angle: 0,004 mm (ring types: T, TB, TBA, and TM);</li> <li>— for <math>7^\circ</math> keystone angle: 0,012 mm (ring types: HK, and HKB);</li> <li>— for <math>15^\circ</math> keystone angle: 0,026 mm (ring types: K, KB, KBA, and KM).</li> </ul> <p>To obtain the correct measured width of the keystone ring, the above values shall be deducted from the measured values.</p> <p>NOTE Values of <math>a_6</math> are given in ISO 6624-1 to ISO 6624-4.</p> <p style="text-align: right;">Dimensions in millimetres</p>  <p style="text-align: center;"><b>Figure 5</b></p>

Characteristic/Definition	Measuring principle/method
	<p><b>Method B</b></p> <p>This method determines <math>a_6</math> for a specified value of <math>h_3</math> (see Figure 4).</p> <p>Measure with a flat face probe exerting a measuring force of approximately 1 N. The ring shall be placed between two sharp edged (radius <math>\leq 0,01</math> mm) circular discs which are spaced apart at the specified gauge width <math>h_3</math> (see Figure 6).</p> <p>NOTE Values of <math>h_3</math> are given in ISO 6624-1 to ISO 6624-4.</p> <p>Dimensions in millimetres</p>  <p style="text-align: center;"><b>Figure 6</b></p>
4.2.2 Radial wall thickness, $a_1$ (in millimetres)	<p>radial distance between the peripheral surface and the inside surface of the ring measured in millimetres (see Figure 7)</p> <p>a) Measure radially between a flat measuring surface on the peripheral surface and a special measuring surface with a radius of approximately 4 mm on the bore using a measuring force of 3 N to 10 N (see Figure 8).</p>  <p style="text-align: center;"><b>Figure 7</b></p>

Characteristic/Definition	Measuring principle/method
	 <p data-bbox="991 662 1102 691"><b>Figure 8</b></p> <p data-bbox="610 718 1483 842">b) Measure radially between cylindrical inserts or rollers of radius approximately 4 mm with a measuring force of 3 N to 10 N. The peripheral surface of the rollers shall be perpendicular to the reference plane.</p> <p data-bbox="610 887 1483 943">The length of the rollers shall be greater than the axial ring width (see Figure 9).</p>  <p data-bbox="991 1313 1102 1347"><b>Figure 9</b></p>
<p data-bbox="187 1381 690 1414"><b>4.2.3 Total free gap <math>m, p</math> (in millimetres)</b></p> <p data-bbox="187 1437 599 1718">chordal distance between the gap ends of the ring in a free unstressed state, measured at the centre line of the radial wall thickness measured in millimetres (see Figure 10); for rings with an internal notch for a peg — chordal distance marked as <math>p</math> in Figure 11</p>	<p data-bbox="610 1437 1198 1471">Measure with a steel rule to the nearest 0,25 mm.</p> <p data-bbox="610 1482 1269 1516"> Optionally, this feature may be measured with callipers.</p>  <p data-bbox="976 1841 1110 1875"><b>Figure 10</b></p>

Characteristic/Definition	Measuring principle/method
	 <p data-bbox="896 646 1023 680"><b>Figure 11</b></p>
<p><b>4.2.4 Closed gap, <math>s_1</math> (in millimetres)</b></p> <p>distance between the gap ends of the ring measured at the narrowest point, which the ring would have when fitted in a gauge of nominal cylinder bore size (see Figure 12)</p> <p>NOTE The closed gap <math>s_1</math> is related to the nominal diameter <math>d_1</math>.</p>	<p>Measure in a bore gauge of nominal diameter using a wedge gauge or feeler gauges and using a measuring force of approximately 1 N (see Figure 12). The diameter of the bore gauge shall comply with</p> $d_1 \begin{matrix} +0,001d_1 \\ 0 \end{matrix}$ <p>Correction shall be made for any deviation of the bore gauge from the nominal ring diameter.</p>  <p data-bbox="896 1482 1023 1516"><b>Figure 12</b></p>

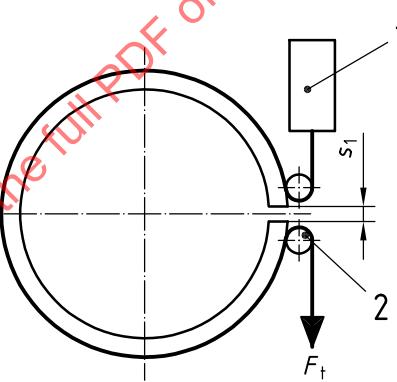
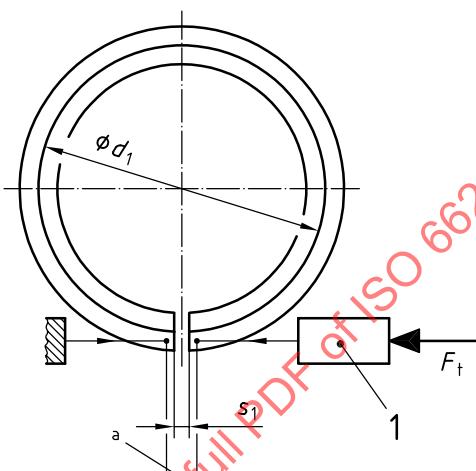
Characteristic/Definition	Measuring principle/method
4.2.5 Tangential force, $F_t$ (in newtons)	
4.2.5.1 Single-piece rings (not recommended for rings $d_1 < 50$ mm — see 4.2.6.)	<p>force necessary to maintain the ring at the closed gap condition by means of a tangential pull on the ends of a circumferential metal tape or hoop (see Figures 13 and 14)</p>
	<p><b>Tape method</b> (see Figure 13)</p> <p>Carry the encircling steel tape of thickness 0,08 mm to 0,10 mm around 10 mm diameter rollers set 20 mm apart (see Figure 13). In tightening the tape, close the ring to the point where the gap ends touch and then open to the closed-gap dimension previously measured. Then read off the ring force from the precision measuring scale. The gap of the ring shall be symmetrically disposed between the rollers.</p> <p>An alternative method to set up the tangential loading of the force measuring instrument is using a solid disc of nominal bore diameter <math>\pm 0,005</math> mm to set up the length of the tape. Insert the gauge disc into the tape and adjust the tape length until the specified mean limit tangential force is indicated.</p>  <p><b>Key</b></p> <p>1 measuring scale 2 diameter of roller = 10 mm</p>

Figure 13

Characteristic/Definition	Measuring principle/method
	<p><b>Hoop method</b> (see Figure 14)</p> <p>Place the ring in a correctly sized hoop with its gap aligned to the gap of the hoop. Then close the hoop in a precision loading machine until the loading pins are at a predetermined distance apart at which point the hoop is precisely at the cylinder bore diameter appropriate to the ring (see Figure 14). Read the force from the display.</p>  <p><b>Key</b></p> <ul style="list-style-type: none"> <li>1 measuring scale</li> <li>a Loading-pin spacing to suit machine.</li> </ul> <p><b>Figure 14</b></p> <p><b>Encircling tape method</b></p> <p>A steel tape 0,08 mm to 0,1 mm in thickness encircles the ring crossing at the gap (see Figure 13).</p> <p>The tape is tightened until the ring is closed to the closed gap previously measured. The ring force is then read off the precision measuring scale.</p> <p><b>NOTE</b> No vibration when measuring single-piece rings according to the three methods.</p>

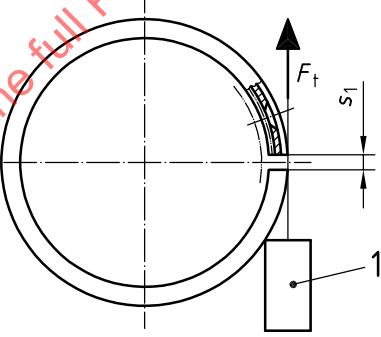
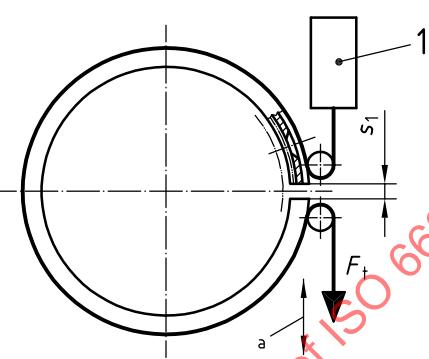
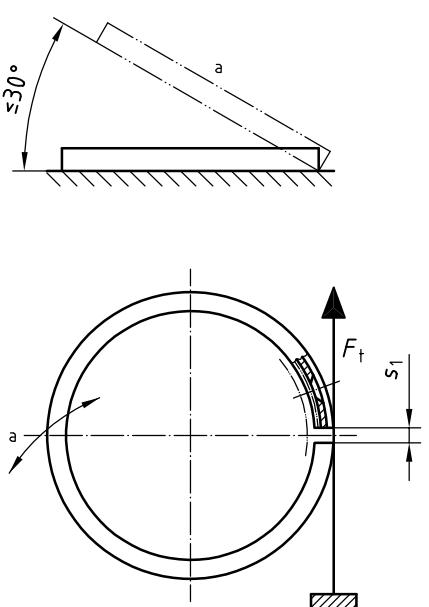
Characteristic/Definition	Measuring principle/method
<p><b>4.2.5.2 Multi-piece rings</b></p> <p>force which is necessary to maintain the ring at the closed gap condition by means of a tangential pull on the ends of a circumferential metal tape or hoop (see Figure 15)</p> <p>NOTE Vibration is used to reduce friction during or prior to measurement.</p>	<p>For the measurement of coil-spring-loaded rings or similar rings where the spring is supported in the bore of the ring, the gap of the spring shall be positioned at <math>180^\circ</math> to the gap of the ring.</p> <p>For the measurement of expander/segment oil-control rings, the ring assembly shall be mounted in a carrier simulating the piston-ring groove. The gap of the spring element shall be placed at <math>180^\circ</math> to the gap of the rails, both of which shall be in line. Choice of ring carrier type (see Table 1) to be decided between manufacturer and client.</p> <p>For the measurement of a ring provided with a wavy spring, or other spring which is groove-root supported, the ring assembly shall be mounted in a carrier simulating the groove, the root diameter of which is equal to the mean diameter of the piston ring groove in which the ring will be used.</p> <p>Tolerance on carrier root diameter <math>\pm 0,02</math> mm. The gap of the wavy spring shall be at <math>180^\circ</math> to the gap of the ring.</p>  <p>Key</p> <p>1 measuring scale</p>

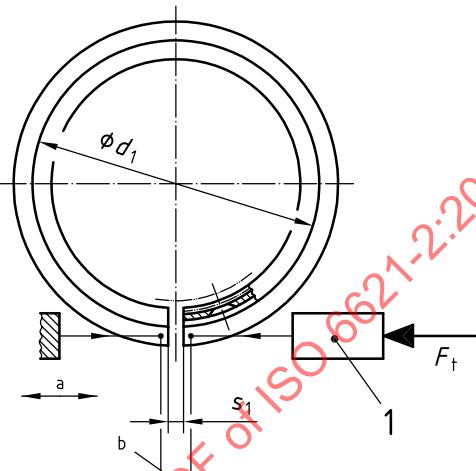
Figure 15

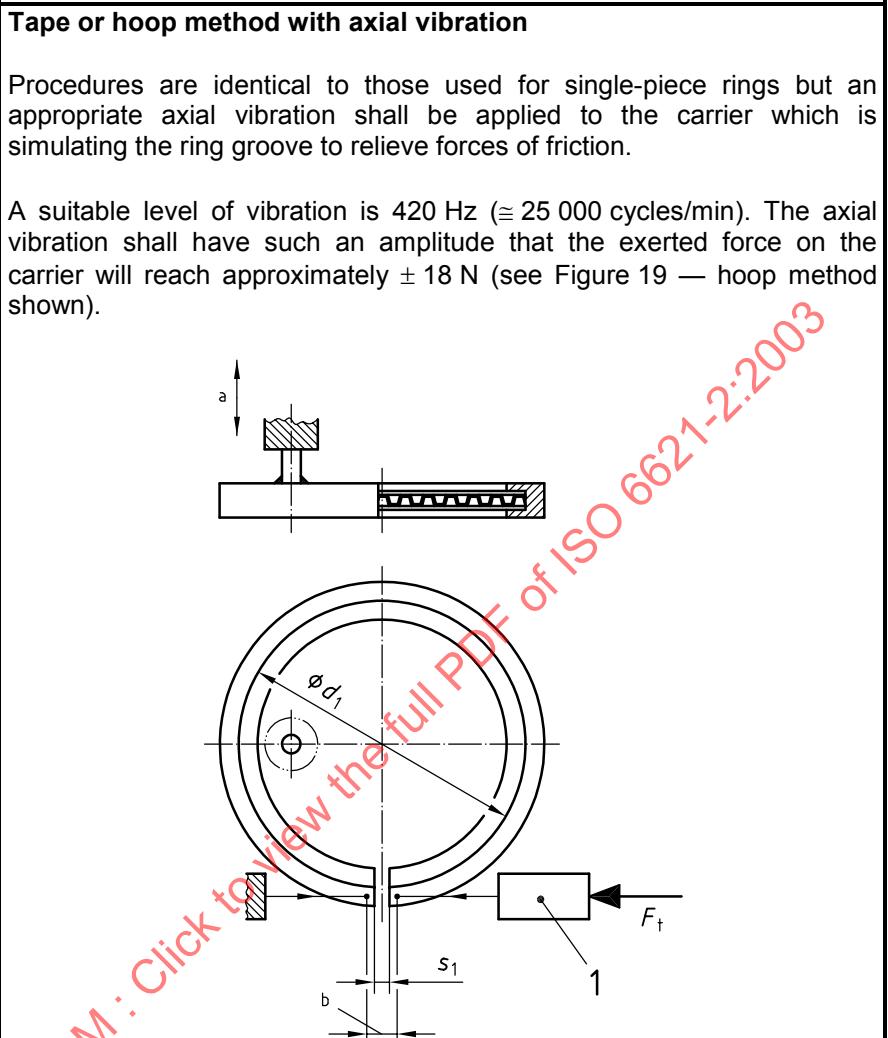
Table 1 — Alternative ring carriers

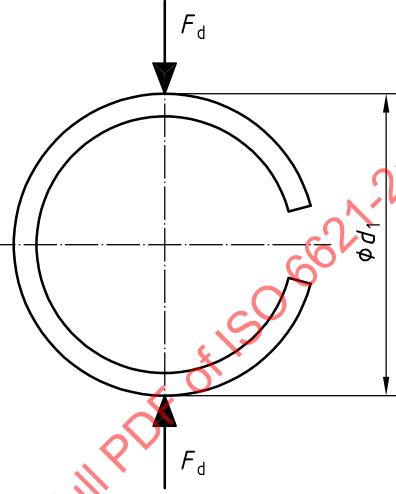
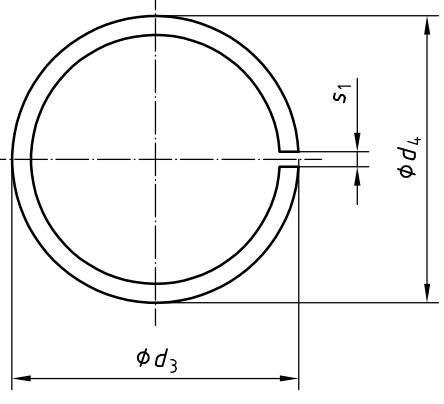
Type	Carrier groove mm	
	Width	Tolerance
I	$h_1 + 0,01$	$+0,02$ $0$
II	$h_1 + 0,02$	
III	$h_1 + 0,03$	

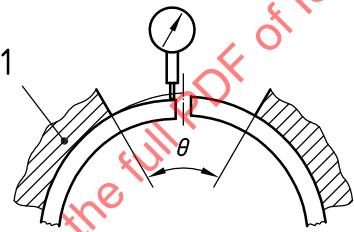
where  $h_1$  = nominal ring width.

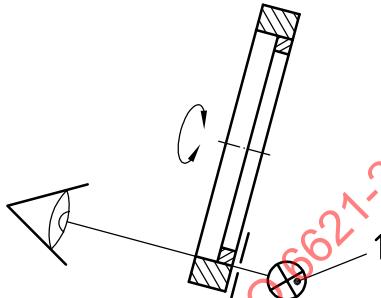
Characteristic/Definition	Measuring principle/method
	<p><b>Tape method with circumferential vibration</b></p> <p>Procedures are identical to those used for single piece rings but an appropriate vibration shall be applied to the tape-loading mechanism to relieve forces of friction (see Figure 16). A suitable level is 40 Hz to 50 Hz at an amplitude of <math>\pm 0,15</math> mm.</p>  <p><b>Key</b></p> <p>1 measuring scale a Vibration.</p> <p><b>Figure 16</b></p> <p><b>Encircling tape method with axial vibration</b></p> <p>Procedures are identical to those used for the single-piece rings (encircling tape method) except that a carrier may be used and vibration (slapping) is applied to the encircled ring or encircled ring with carrier to reduce friction (see Figure 17). A suitable level of slapping is 1 to 3 times/s.</p>  <p><b>Figure 17</b></p>

Characteristic/Definition	Measuring principle/method
	<p><b>Hoop method with circumferential vibration</b></p> <p>Procedures are identical to those used for single-piece rings but an appropriate vibration shall be applied to the hoop loading mechanism to relieve all forces of friction (see Figure 18).</p>  <p><b>Key</b></p> <ul style="list-style-type: none"> <li>1 measuring scale</li> <li>a Vibration.</li> <li>b Loading-pin spacing to suit machine.</li> </ul> <p style="text-align: right;"><b>Figure 18</b></p>

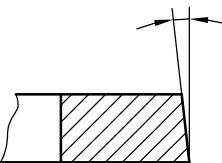
Characteristic/Definition	Measuring principle/method
	<p><b>Tape or hoop method with axial vibration</b></p> <p>Procedures are identical to those used for single-piece rings but an appropriate axial vibration shall be applied to the carrier which is simulating the ring groove to relieve forces of friction.</p> <p>A suitable level of vibration is 420 Hz (<math>\approx 25\ 000</math> cycles/min). The axial vibration shall have such an amplitude that the exerted force on the carrier will reach approximately <math>\pm 18</math> N (see Figure 19 — hoop method shown).</p>  <p><b>Key</b></p> <ul style="list-style-type: none"> <li>1 measuring scale</li> <li>a Axial vibration.</li> <li>b Loading-pin spacing to suit machine.</li> </ul> <p><b>Figure 19</b></p> <p>Before tangential force measurements are made, rings shall be degreased and optionally lightly coated with thin machine oil.</p> <p>Closed-gap measurements should be made immediately prior to measuring tangential force.</p> <p>In order to improve consistency of measurement and particularly with coil-spring-loaded rings which have been oxidized or phosphated, it is permissible to rotate the spring forwards and backwards to smooth the surface before carrying out measurements.</p> <p>The manufacturer and client should agree on a suitable factor to take account of different machines, different locations and different operators.</p> <p><b>NOTE</b> The reproducibility of tangential-force measurements has not been high in the past but current machines using encircling tape and hoop methods give an overall reproducibility of the order of 10 %.</p>

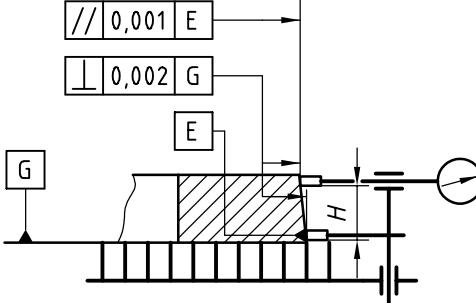
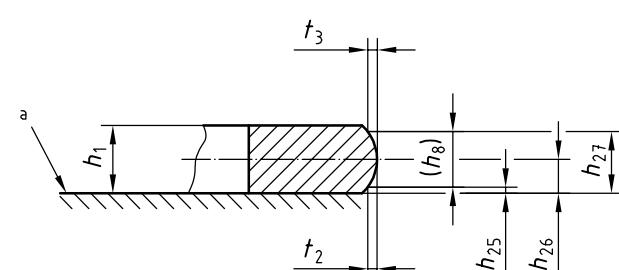
Characteristic/Definition	Measuring principle/method
<p><b>4.2.6 Diametral force, <math>F_d</math> (in newtons)</b></p> <p>force, acting diametrically at 90° to the gap, necessary to maintain the ring at the nominal diameter condition measured in the direction of the force (see Figure 20)</p>	<p>NOTE This method is applicable only to single-piece rings. Measure in purpose-built machines which incorporate flat plates for closing the rings (see Figure 20).</p>  <p style="text-align: center;"><b>Figure 20</b></p>
<p><b>4.2.7 Ovality, <math>U</math> (in millimetres)</b></p> <p>difference between the mutually perpendicular diameters <math>d_3</math> and <math>d_4</math> when the ring is drawn to closed gap within a flexible tape</p> <p>NOTE It may be either positive (<math>d_3 &gt; d_4</math>) or negative (<math>d_3 &lt; d_4</math>) (see Figure 21).</p>	<p>NOTE This method is applicable only to single-piece rings. Measure with the ring drawn to its closed gap in a flexible steel tension tape or band of thickness 0,08 mm to 0,10 mm using a diametral measuring device exerting a measuring force of <math>\leq 1</math> N (see Figure 21).</p> <p>With the ring closed within the tape, it is an acceptable alternative to clamp it between plates and then remove the tape prior to measuring the diameters <math>d_3</math> and <math>d_4</math>. However, clamping of the ring between plates is not applicable to oil control rings with slots.</p>  <p style="text-align: center;"><b>Figure 21</b></p>

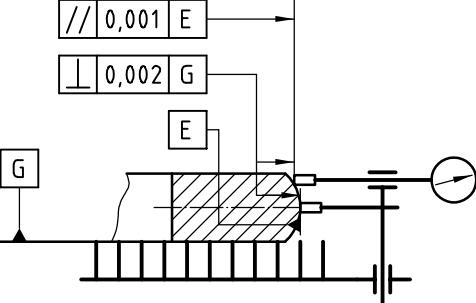
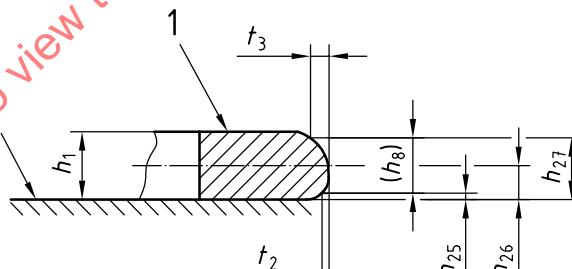
Characteristic/Definition	Measuring principle/method
<p><b>4.2.8 Point deflection, <math>W</math> (in millimetres)</b></p> <p>deviation of the butt ends from the true circle when restrained in a gauge of nominal cylinder-bore diameter (see Figure 22)</p>	<p>Measure with a probe of spherical radius <math>1,5 \text{ mm} \pm 0,05 \text{ mm}</math> using a measuring force of approximately <math>1 \text{ N}</math>, with the ring mounted in a gauge of nominal cylinder-bore diameter relieved over the gauge angle, <math>\theta</math>, (see Figure 22).</p> <p>Point deflection <math>W</math> and the gauge angle <math>\theta</math> shall be agreed between manufacturer and client.</p> <p>The following gauge tolerances apply for this test:</p> <ul style="list-style-type: none"> <li>— angle <math>\theta</math>: <math>\pm 1^\circ</math></li> <li>— diameter: <math>d_1 {}^{+0,001d_1}_0</math></li> <li>— circularity: <math>\leq 0,0001d_1</math></li> </ul>  <p><b>Key</b> 1 gauge</p> <p><b>Figure 22</b></p>
<p><b>4.2.9 Light tightness (percentage of ring circumference)</b></p> <p>ability of the peripheral surface of a ring when mounted in a gauge of nominal cylinder-bore diameter to exclude the passage of light (see Figure 23)</p> <p>NOTE Areas of the ring showing pinpoint, burry or fuzzy light are considered light-tight.</p>	<p>Measure in a gauge equipped with a suitable light source and determine the percentage of the ring circumference which will allow light to pass (see Figure 23).</p> <p>It is permissible to rotate the ring in the gauge to remove any slight surface roughness on the peripheral surface. Unless otherwise specified, examination and measurement should be made without magnification and with normal eyesight. It is important to avoid errors of parallax and to protect the viewer against stray light penetration.</p>

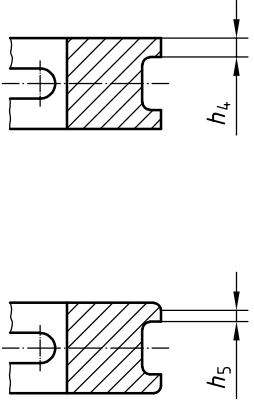
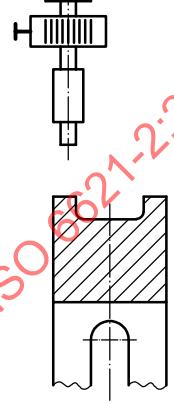
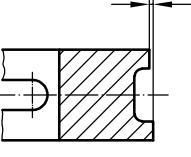
Characteristic/Definition	Measuring principle/method
	<p>Luminance behind the ring shall be 400 lx to 1 500 lx above the ambient conditions. The following gauge tolerances apply for this test:</p> <ul style="list-style-type: none"> <li>— diameter: <math>d_1 \text{ } 0^{+0,001d_1}</math></li> <li>— circularity: <math>\leq 0,0001d_1</math></li> </ul>  <p><b>Key</b> 1 lamp</p> <p><b>Figure 23</b></p>

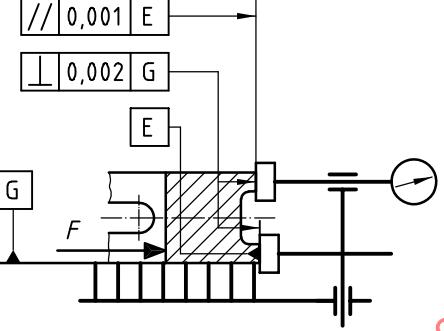
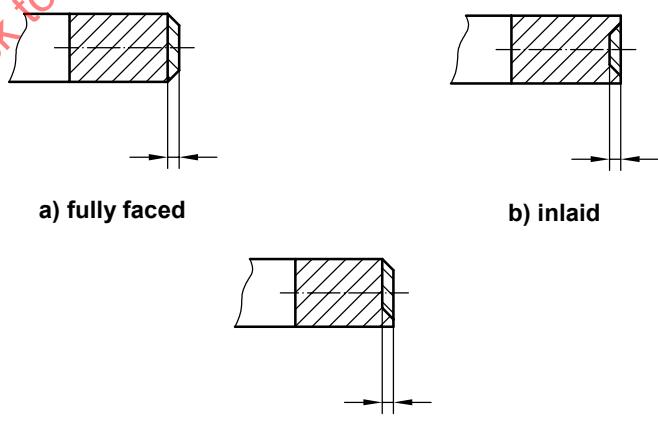
#### 4.2.10 Taper on peripheral surface (in micrometres or degrees)

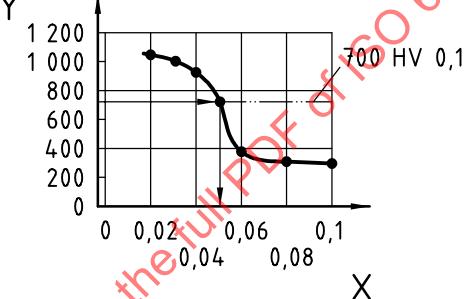
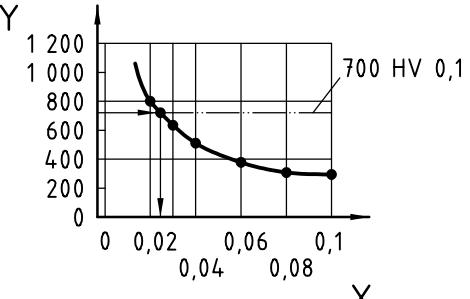
intentional angular deviation of the peripheral surface from a line perpendicular to the reference plane (see Figure 24)  <b>NOTE</b> In the case of the taper faced peripheral surface with partly cylindrical area, both measuring points have to be placed on the taper area.	<p><b>Method A</b></p> <p>Measure at the back of the ring perpendicular to the reference plane using flat faced probes exerting a force of approximately 1 N (see Figure 25).</p> <p>The measurement recorded is the difference in radial dimension of the ring peripheral surface between two points, near the top and near the bottom, distance <math>H</math> apart. <math>H</math> shall be approximately two-thirds of the total axial width of the ring's peripheral surface and the recorded measurement may be converted to the taper angle in degrees or minutes.</p>  <p><b>Figure 24</b></p>
--	---

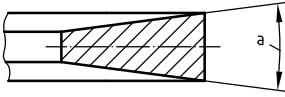
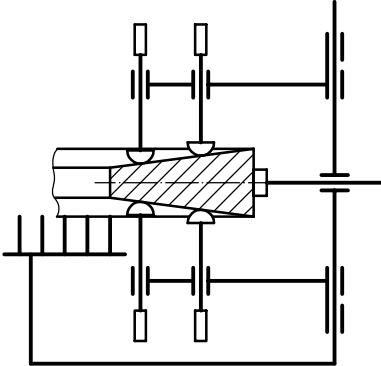
Characteristic/Definition	Measuring principle/method
	 <p><b>Figure 25</b></p> <p><b>Method B</b></p> <p>Place the ring on a reference plane and graph the peripheral surface of the back of the ring, perpendicular to the reference plane, using a profile recorder.</p> <p>The magnification used shall be clearly indicated.</p> <p><b>NOTE</b> The same methods can be used to determine the unintentional taper which could be present on, for example, a nominally straight faced rectangular ring.</p>
<p><b>4.2.11 Barrel on peripheral surface, <math>t_2</math>, <math>t_3</math> (in millimetres)</b></p> <p>intentional convex deviation of the peripheral surface from a line perpendicular to the reference plane (see Figure 26 for symmetrical barrel and Figure 28 for asymmetrical barrel)</p>	<p><b>Method A</b></p> <p>Measure at the back of the ring perpendicular to the reference plane using flat-faced probes exerting a force of approximately 1 N (see Figure 27).</p> <p>The measurement recorded is the difference in radial dimension of the ring peripheral surface between two points — one at the peak of the barrel (at or near the centre line of the ring), and the second at a distance <math>h_8/2</math> from the centreline of the nominal ring width <math>h_1</math>.</p>  <p>a Reference plane.</p> <p><b>Figure 26</b></p>

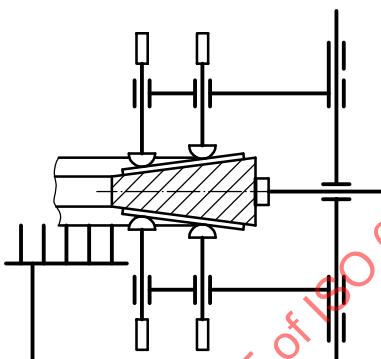
Characteristic/Definition	Measuring principle/method
	 <p data-bbox="976 651 1110 685"><b>Figure 27</b></p> <p data-bbox="603 707 730 741"><b>Method B</b></p> <p data-bbox="603 759 1475 853">Mount the ring on a reference plane and graph the peripheral surface of the back of the ring, perpendicular to the reference plane, using a profile recorder.</p> <p data-bbox="603 875 1475 932">The magnification used shall be clearly indicated (recommended ratio between vertical and horizontal magnifications: 10 or 25).</p> <p data-bbox="603 954 1475 1044">NOTE The same methods can be used to determine the unintentional barrel which could be present on, for example, a nominally straight-faced rectangular ring.</p>  <p data-bbox="603 1381 1031 1414">Gauge width (<math>h_8</math>) is for information only.</p> <p data-bbox="603 1426 650 1459"><b>Key</b></p> <p data-bbox="603 1471 714 1500">1 mark</p> <p data-bbox="603 1516 825 1545">a Reference plane.</p> <p data-bbox="976 1560 1110 1594"><b>Figure 28</b></p>

Characteristic/Definition	Measuring principle/method
<p><b>4.2.12 Land width, <math>h_4</math>, <math>h_5</math> (in millimetres)</b></p> <p>width of the land which theoretically should be in contact with the cylinder bore (see Figure 29)</p>	<p><b>Method A</b></p> <p>For all forms of land (sharp edge, chamfered or radiused), measure with a measuring microscope or on a projector. The measurement shall be made only on the peripheral surface of the lands (see Figure 30).</p> <div style="display: flex; justify-content: space-around; align-items: flex-end;"> <div style="text-align: center;">  <p><b>Figure 29</b></p> </div> <div style="text-align: center;">  <p><b>Figure 30</b></p> </div> </div> <p><b>Method B</b></p> <p>For all forms of land, place the ring on a reference plane and graph the lands on a profile recorder.</p> <p>The magnification used shall be clearly stated.</p> <p>NOTE Land offset (see 4.2.13) can be included and obtained from this measurement at the back of the ring.</p>
<p><b>4.2.13 Land offset (in millimetres)</b></p> <p>displacement of the two peripheral surfaces of a slotted or drilled oil control ring in relation to each other in a radial direction (see Figure 31)</p>	<p><b>Method A</b></p> <p>Measure at the back of the ring from a line perpendicular to the reference plane (see Figure 31) using flat measuring probes exerting a force of approximately 1 N. The ring shall be loaded against the measuring instrument in the direction of and in the position of the force <math>F</math> (see Figure 32). The value of force <math>F</math> shall be in the range of 3 N to 5 N.</p> <div style="text-align: center;">  <p><b>Figure 31</b></p> </div>

Characteristic/Definition	Measuring principle/method
	 <p><b>Figure 32</b></p> <p><b>Method B</b></p> <p>See 4.2.12, Method B.</p>
<b>4.2.14 Plating/coating thickness</b> (in millimetres)	
distance between the outer surface of the plating/coating and the surface of the base ring material connected with the different configurations of platings/coatings (see Figure 33)	<p>Measure non-destructively in the middle of the width of plating/coating using a calibrated inductive thickness-measuring instrument. The calibration shall be made using a master ring being tested.</p> <p>Suggested points for measuring are at the back of the ring and at 15 mm from each gap end.</p> <p>The plating/coating thickness shall comply with the specification at any particular point of the peripheral surface.</p>  <p><b>a) fully faced</b></p> <p><b>b) inlaid</b></p> <p><b>c) semi-inlaid</b></p> <p><b>Figure 33</b></p>

Characteristic/Definition	Measuring principle/method
<p><b>4.2.15 Nitrided case depth (in millimetres)</b></p> <p>thickness of the surface layer with a hardness value <math>\geq 700 \text{ HV } 0,1</math> measured perpendicular to the ring peripheral surface or side faces</p>	<p>Measure on prepared cross sections of the ring. Measure the micro-hardness <math>\text{HV } 0,1</math> at various distances from the peripheral or side face surfaces. Recommended increments are <math>0,01/0,015/0,02</math>.</p> <p>The hardness values should be plotted against the perpendicular distance from the surface and the hardness characteristic curve drawn through the points in accordance with proper mathematical principles</p> <p>EXAMPLE 1 Nitrided case depth <math>0,05 \text{ mm}</math> (NT050) — see Figure 34.</p> <p>EXAMPLE 2 Nitrided case depth <math>0,25 \text{ mm}</math> (NS020) — see Figure 35.</p> <p>The diagrams in Figures 34 and 35 show typical shapes of hardness curves.</p>  <p><b>Key</b></p> <p>X measuring distance Y hardness</p> <p><b>Figure 34</b></p>  <p><b>Key</b></p> <p>X measuring distance Y hardness</p> <p><b>Figure 35</b></p>

Characteristic/Definition	Measuring principle/method
	<p>The depth at which the hardness characteristic curve crosses the 700 HV 0,1 line is the case depth.</p> <p>Measure hardness "HV 0,1" in accordance with the appropriate International Standard, i.e. ISO 6507-3, and using any suitable hardness measuring machine.</p> <p>Suggested positions for establishing the cross-sections for the hardness measurements are at the back of the ring and at 15 mm from each gap end.</p> <p>For thinner nitrided case depths, where it is impractical to apply the hardness measurement method (e.g. on expanders or segments), an alternative method (e.g. micro-analysis of the etched ring cross-section) may be agreed between manufacturer and client.</p> <p>NOTE 1 Reliable non-destructive measuring principles for determining the "Nitrided case depth" of nitrided piston rings are not known up to now.</p> <p>NOTE 2 Nitrided case depth has to fulfil the specification at any particular point of the peripheral surface and/or the ring side faces.</p>
<b>4.2.16 Keystone angle (in degrees)</b>	
angle enclosed by the two sides of the ring (see Figure 36); alternatively, sum of both side face angles, i.e. included angle	<p><b>Method A</b></p> <p>Measure in a true radial direction at the back of the ring the difference in ring width at two points of known distance apart using spherical probes each of radius <math>1,5\text{ mm} \pm 0,05\text{ mm}</math> exerting a force of approximately 1 N.</p> <p>The keystone angle can then be calculated as the sum of both side angles (see Figure 37).</p> <div style="display: flex; justify-content: space-around; align-items: flex-end;"> <div style="text-align: center;">  <p>a      Included angle.</p> <p><b>Figure 36</b></p> </div> <div style="text-align: center;">  <p><b>Figure 37</b></p> </div> </div>

Characteristic/Definition	Measuring principle/method
	<p><b>Method B</b></p> <p>Measure in a true radial direction at the back of the ring the difference in ring width using two probe systems formed as knife edges, each probe exerting a force of approximately 1 N.</p> <p>The keystone angle can then be calculated as the sum of both side angles (see Figure 38).</p>  <p><b>Figure 38</b></p> <p><b>Methods C and D</b></p> <p>Both Methods C and D involve the use of a probe which traverses in a true radial direction a known distance across the side face at the back of the ring. The probe has a spherical radius of <math>1,5 \text{ mm} \pm 0,05 \text{ mm}</math> and exerts a force of approximately 1 N. The reference-plane plate on which the ring rests for measurement is provided with a location to ensure that the line of measurement is truly radial (see Figure 41).</p> <p><b>Method C</b></p> <p>Incline the reference plane plate at an angle equal to the nominal side face angle of the ring and such that the contact surface of the probe traverses a path nominally parallel to the axis of the motion of the probe.</p> <p>The probe measures any deviation of the side face from parallel and allows the actual angular deviation to be calculated. Hence the actual side face angle can be determined.</p> <p>Measure the ring on both sides and use the sum of the side face angles to give the keystone angle (see Figure 39).</p>